





### **MATERIAL**

Anti Vibration Bushing: TPE Bushing: Steel, zinc plated

**Cam:** Hardened steel, anti-friction coating **Clip:** Glass fibre reinforced polyamide

(PA6GF30)

Housing: Steel, zinc plated Striker: Steel, zinc plated Trigger: Hardened steel, zinc plated

#### **RELATED PRODUCTS**

**Needed components for a complete system:** 2-850, 2-745, 2-746, 2-835, 2-860 **Similar products:** 2-750-01, 2-750-03, 2-

750-04, 2-750-07


Use the Index Code at industrilas.com


# VECTOR ROTARY LATCH - INLINE BOTTOM PULL

Vector rotary latches offer concealed latch points with convenient push-to-close action. Vector Rotaries are suitable for a variety of applications that require high strength, robust and secure latching. They are employed either as single latch point or in a multipoint latching system. Available in either single or two stage latching. The two stage rotary offers a safety feature that securely latches a partially latched compartment. Specially engineered to offer minimized trigger release force that ensures smooth and easy opening.

Vector rotaries are combined with Vector actuators that connect to the rotary latch by Vector rods or cables, creating an optimized latching system with components easily and securely fitted together. Please see related products to choose your components for your complete Vector rotary latching system.

The image displays a right version (see table below).

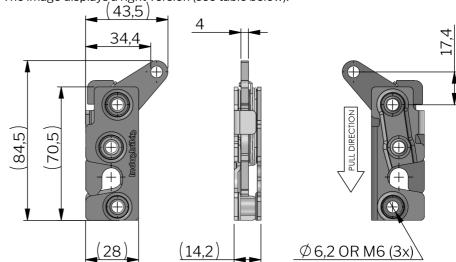

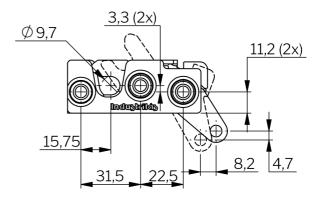



## INDUSTRILAS.COM

# Make your selections in each column to create your article number (AAAA-BBCDEFFG-HH)

АА	AA Type	BB Material	C Type	D Type of jaw	E Mounting hole	FF Trigger	G Left/ Right	HH Striker
5223	Rotary for 9,4	Steel, zinc	Single	1 Single 1 jaw	Through	Inline 02 Bottom Pull	1 Right	00 No striker
	mm striker	plated	stage		hole		2 Left	With striker
52:	,		2 Double stage		1 M6 threaded			01 bolt UNC 5/16-18
	mm striker				2 UNC 1/4- 20			02 With striker bolt M8
								03 With looped striker
								04 With riveted striker

<sup>\*</sup> Anti-BSR means no Buzz, Squeak or Rattle due to TPE anti vibration bushing.

